





PSR 2021-2023 Harley touring & trike cable clutch lever installation CH3A

*** This component should be installed & tested by a certified mechanic or qualified technician. If unsure of product to bike application, do not install! Please contact your dealer or PSR immediately.

1. Loosen clutch cable at the disconnect/adjustment joint
2. Remove lever mounting bolt circlip underneath the clutch lever & remove mounting bolt
3. Remove clutch cable tab and detached cable from the stock lever
4. Make note of the spring orientation on the stock lever. Use a 6mm or 1/4" socket & press out the spring retaining spacer carefully from stock lever and remove spring

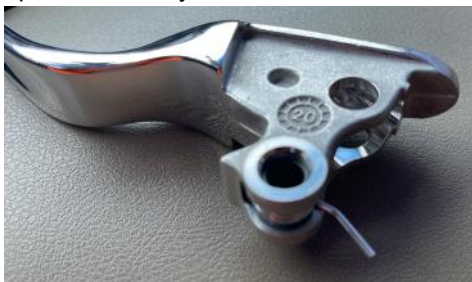

5. Install spring in PSR lever and press in the spring retaining spacer
 6. Attach clutch cable end to PSR lever using stock cable tab.
 7. Using flashlight to locate tiny hole inside the housing & insert lever spring end into that hole.
- *** good eye sight and patience will Git-R-Done ***
8. Line up lever & perch, insert lever mounting bolt, install circlip to mounting bolt.
 9. Set desired adjustment setting on the lever dial per rider preference
 10. Set clutch cable free play on minimal. Check & verify lever functions properly.

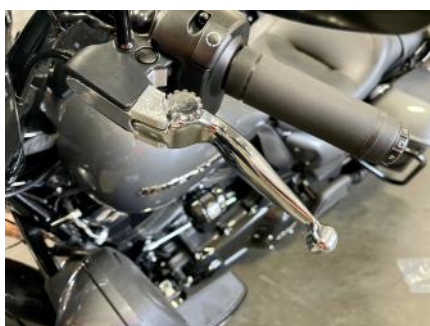

Enjoy the Ride!

PSR 157 Stare St Pomona California 91767 USA PSR-USA.com 909-593-8768. PATENT PENDING

Professional installation is recommended. Always use proper safety measures during the install of this product. Do not try to install this product without proper tools, recently calibrated torque wrench, correct torque specifications from factory service manual, safety goggles and gloves. The motorcycle must be in a fixed secure position before the install process begins. PSR is not responsible for any losses, damages or claims resulting from injuries sustained or alleges to have been sustained by the installation of this product not installed by a certified mechanic experienced in the installation of component parts on motorcycles. PSR is not responsible for the functionality of the product not properly installed or under circumstances in which there has been a modification to the product by any person not employed by PSR.